

FLUKE®

**Test Equipment
Depot**

1-800-517-8431

99 Washington Street
Melrose, MA 02176
Phone 781-665-1400
Toll Free 1-800-517-8431



Visit us at www.TestEquipmentDepot.com

902

HVAC Clamp Meter

Users Manual

99 Washington Street
Melrose, MA 02176
Fax 781-665-0780
TestEquipmentDepot.com

Table of Contents

Title	Page
Introduction.....	1
Contacting Fluke	2
Safety Information	3
Symbols	5
Getting Acquainted with the Meter	6
Using the Meter	10
AC and DC Voltage Measurement.....	10
Resistance and Continuity	11
Microamps μ A Measurement	12
Temperature	13
Capacitance	16
AC Current Measurement	16
Backlight	18
MIN MAX Recording Mode	18
Display HOLD	19
Auto Off.....	19
Maintenance.....	20
Cleaning the Meter.....	20
Battery Replacement	21
Specifications	23
Electrical Specifications	23
General Specifications	24

List of Tables

Table	Title	Page
1.	902 HVAC Clamp Meter Features	7
2.	Display Features	9

List of Figures

Figure	Title	Page
1.	902 HVAC Clamp Meter Features	6
2.	Display Features	8
3.	Testing a Flame Rod	13
4.	Temperature Measurement	15
5.	Proper AC Current Measurement	17
6.	Battery Replacement	22

Introduction

The Fluke 902 is a hand-held battery-operated HVAC Clamp Meter (“the Meter”) that measures:

- AC current
- DC current (up to 200 μ A for flame rod testing)
- AC and DC voltages
- Capacitance
- Resistance
- Continuity
- Temperature in both Celsius ($^{\circ}$ C) and Fahrenheit ($^{\circ}$ F)

The Meter comes with:

- Two AA alkaline batteries (installed)
- Users Manual
- Soft carrying case
- TL75 Test Leads (one pair)
- 80BK Integrated DMM Temperature Probe

Safety Information

A “**⚠️⚠️ Warning**” statement defines hazardous conditions and actions that could cause bodily harm or death.

A “**⚠️ Caution**” statement identifies conditions and actions that could damage the Meter or the equipment under test.

⚠️⚠️ Read First: Safety Information








 





To ensure safe operation and service of the Meter, follow these instructions:

- **Read the Users Manual before use and follow all safety instructions.**
- **Use the Meter only as specified in the Users Manual; otherwise, the Meter's safety features may be impaired.**
- **Avoid working alone so assistance can be rendered.**
- **Never use the Meter on a circuit with voltages higher than 600 V or a frequency higher than 400 Hz fundamental. The Meter may be damaged.**
- **Never measure ac current while the test leads are inserted into the input jacks.**
- **Do not use the Meter or test leads if they look damaged.**
- **Use extreme caution when working around bare conductors or bus bars. Contact with the conductor could result in electric shock.**

- **Use caution when working with voltages above 60 V dc or 30 V ac rms or 42 V ac peak. Such voltages pose a shock hazard.**
- **Clean the case with a damp cloth and mild detergent only. Do not use abrasives or solvents.**
- **To avoid false readings that can lead to electrical shock and injury, replace the batteries as soon as the low battery indicator (🔋) appears. As the Meter gets to the point where the low batteries affect the readings, the Meter locks and no measurements can be made until the batteries are changed.**
- **Do not hold the Meter anywhere beyond the tactile barrier, see Figure 1.**
- **Adhere to local and national safety codes. Individual protective equipment must be used to prevent shock and arc blast injury where hazardous live conductors are exposed.**


Symbols

The following symbols are found on the Meter or in this manual.

	May be used on hazardous live conductors
	Risk of danger. Important information. See Users Manual.
	Hazardous voltage. Risk of electric shock.
	Double insulation
	Battery
	Complies with Canadian and US Standards
	Conforms to relevant European Union directives
	Earth ground
	DC (Direct Current)
	AC (Alternating Current)
	Do not dispose of this product as unsorted municipal waste. Contact Fluke or a qualified recycler for disposal.
 N10140	Conforms to relevant Australian standards
	Inspected and licensed by TÜV Product Services

Getting Acquainted with the Meter

Refer to Figures 1 and 2 and Tables 1 and 2 to become more acquainted with the Meter's features.

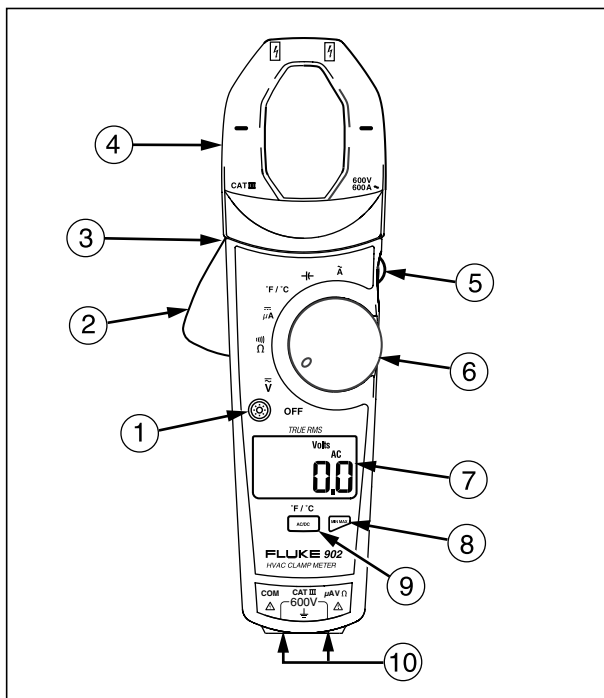


efu0001.eps

Figure 1. 902 HVAC Clamp Meter Features

HVAC Clamp Meter
Getting Acquainted with the Meter

Table 1. 902 HVAC Clamp Meter Features

Number	Description
①	Backlight Button
②	Jaw Release
③	Tactile Barrier
④	Jaws
⑤	Hold Button
⑥	Rotary Switch: \bar{V} DC and AC voltage Ω Resistance and continuity $\mu\bar{A}$ DC microamps $^{\circ}\text{F}/^{\circ}\text{C}$ Degrees Fahrenheit / degrees Celsius $\text{--}\text{ }\text{--}$ Capacitance \tilde{A} AC current
⑦	LCD
⑧	Min Max Button
⑨	AC/DC, $^{\circ}\text{F}/^{\circ}\text{C}$ Button
⑩	Input Terminals

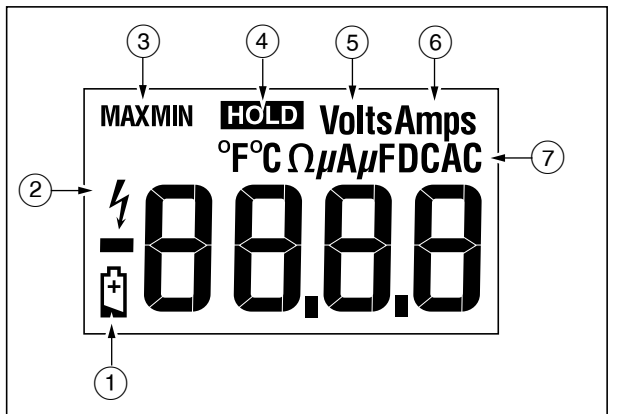

efu0006.eps

Figure 2. Display Features

Table 2. Display Features

Number	Indication
①	Battery indicator -The batteries are low and need to be changed. ⚠ ⚠ Warning: To avoid false readings, which could lead to possible electric shock or personal injury, replace the batteries as soon as the battery indicator appears.
②	Indicates the presence of high voltage
③	Indicators for minimum and maximum recording mode
④	Display Hold is active
⑤	Volts
⑥	Amps
⑦	°F - Degrees Fahrenheit °C - Degrees Celsius Ω - Ohms μA - Microamps μF - Microfarads DC - Direct Current AC - Alternating Current

Using the Meter

AC and DC Voltage Measurement

To measure AC or DC voltage:

1. Insert the test leads into the Meter.
2. Turn the rotary switch to \tilde{V} .
3. Press to choose AC or DC voltage. The display reflects the chosen voltage mode.
4. Use the test leads to take the measurement. The Meter reading appears on the display.

Note

When a measured voltage is above 30 V, \tilde{V} appears on the display. When the voltage drops below 30 V, \tilde{V} disappears.

Resistance and Continuity

To measure resistance or continuity:

⚠ ⚠ Warning


To avoid false readings that can lead to electrical shock and injury, de-energize the circuit before taking the measurement.

1. Insert the test leads into the Meter.
2. Turn the rotary switch to Ω .
3. Take the measurement. The resistance reading appears on the display.
 - If the resistance is shorted, the Meter beeps and shows a reading $< 30 \Omega$.
 - If the resistance is open or exceeds the Meter's range, the display reads **OL**.

Microamps μA Measurement

The μA dc ($\overline{\mu\text{A}}$) function on the Meter is primarily for HVAC flame rod testing. To test a heating system flame rod (refer to Figure 3):

1. Turn the heating unit off and locate the wire between the gas-burner controller and the flame rod.
2. Break this connection.
3. Turn the rotary switch on the Meter to $\overline{\mu\text{A}}$.
4. Using alligator clips, connect test leads between the flame sensor probe and control-module wire.
5. Turn heating unit on and check the reading on the Meter.
6. Refer to the heating unit documentation for what the desired reading should be.

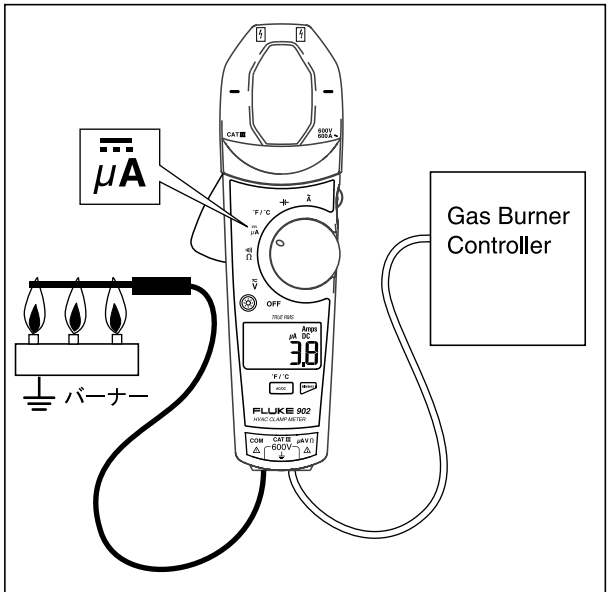

 
efu0004.eps

Figure 3. Testing a Flame Rod

Temperature

The Meter measures temperature in either Celsius (°C) or Fahrenheit (°F).

To measure temperature (refer to Figure 4):

1. Connect the 80BK Integrated DMM Temperature Probe to the input jacks noting correct polarity of the probe.
2. Turn the rotary switch to °F/°C .
3. Press  to select °C or °F. The display reflects the chosen temperature mode.
4. Position the probe to take the measurement. The reading appears on the display.

Note


To meet stated accuracy, the 80BK and Meter must be at the same temperature.

 **Warning**

To avoid possible electric shock DO NOT apply the probe tip to any conductor that is greater than 30 V ac, 42 V peak or 60 V dc to earth.

HVAC Clamp Meter

Using the Meter

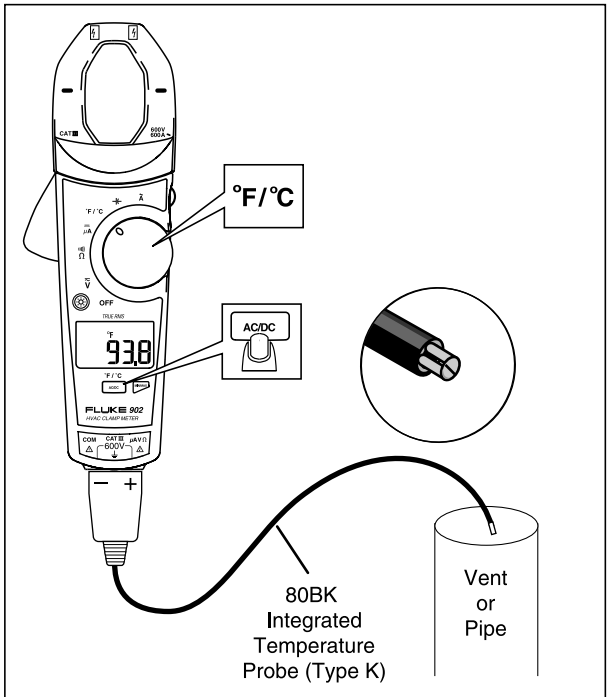

efu0005.eps

Figure 4. Temperature Measurement

Capacitance

Turn off circuit power, then disconnect and discharge the capacitor before measuring capacitance. Turn the Meter's rotary switch to capacitance (⌘).

If the capacitor requires more discharging, **diSC** is displayed while the capacitor discharges. When measuring, be sure to note the correct polarity of the capacitor.

AC Current Measurement

Warning

To avoid electrical shock and injury:

- **Remove Test Leads before making current measurements.**
- **Do not hold the Meter anywhere beyond the tactile barrier, see Figure 1.**

Turn the rotary switch to AC current (⌘). When measuring AC current, it is necessary that the measured wire be properly seated within the clamp jaws. The wire being measured should be centered within the jaws, below the horizontal line located on the clamp. Also note that currents moving in different directions will cancel each other out, so one wire must be measured at a time for a correct measurement (see Figure 5).

HVAC Clamp Meter Using the Meter

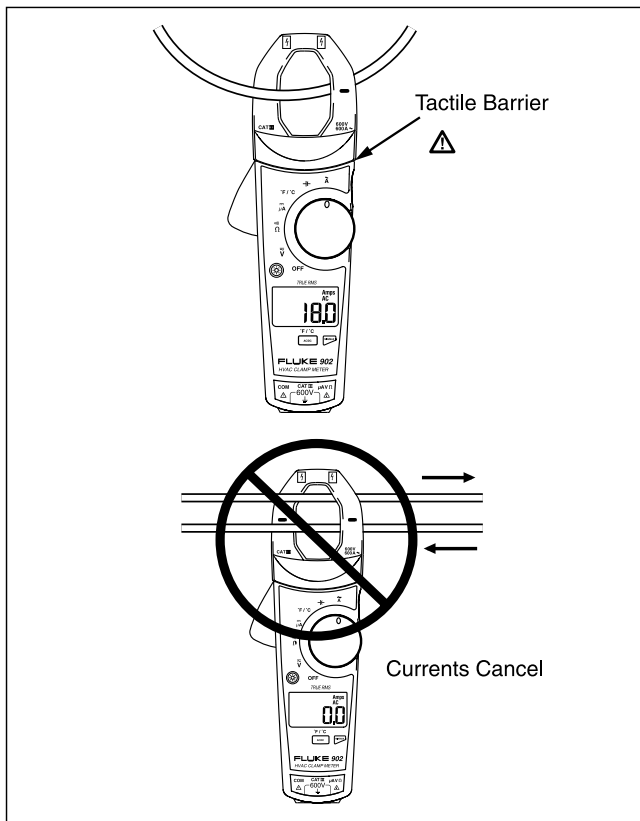



Figure 5. Proper AC Current Measurement

efu0003.eps

Backlight






Press  to toggle the backlight on and off. The backlight automatically turns off after 2 minutes.

To disable the automatic 2-minute backlight timeout, hold down  while turning the Meter on.

MIN MAX Recording Mode

The MIN MAX recording mode captures the minimum and maximum input values. When a new high or low is detected, the Meter beeps.

To use this feature:


1. Put the Meter into the desired measurement function and range.
2. Press  to enter MIN MAX Mode. **MAX** is displayed and the highest reading detected since entering MIN MAX is displayed.
3. Press  to step through the minimum (**MIN**) and present readings.
4. To pause MIN MAX recording without erasing stored values, press . **HOLD** is displayed.
5. To resume MIN MAX recording, press  again.
6. To exit and erase stored readings, press  for at least two seconds.

Display HOLD

⚠ ⚠ Warning


To avoid possible electric shock or personal injury, when Display HOLD is activated, be aware that the display will not change when you apply a different voltage.

In the Display HOLD mode, the Meter freezes the display. The Meter also beeps every 4 seconds and **HOLD** flashes to remind the user.

Press  to activate Display HOLD; **HOLD** is displayed and the reading is captured.

To exit and return to normal operation, press .

Auto Off

The Meter automatically turns off after 20 minutes. The rotary switch must be turned to “**OFF**” and then turned back on for the Meter to restart. Auto Off is disabled during Min Max mode. To disable Auto Off, hold  when turning the Meter on.

Maintenance

⚠️⚠️ Warning

To avoid possible electric shock or personal injury, repairs or servicing not covered in this manual should be performed only by qualified personnel.

Cleaning the Meter

⚠️⚠️ Warning

To avoid electrical shock, remove any input signals before cleaning.

⚠️ Caution

To avoid damaging the Meter, do not use aromatic hydrocarbons or chlorinated solvents for cleaning. These solutions will react with the plastics used in the Meter.

Clean the instrument case with a damp cloth and mild detergent.

Battery Replacement


⚠ ⚠ Warning

To avoid false readings that could lead to possible electric shock or personal injury, replace the batteries as soon as the low battery indicator (🔋) appears.

Disconnect the test leads before replacing the batteries.

To replace the batteries (refer to Figure 6):

1. Turn the rotary switch to “**OFF**” and remove the test leads from the terminals.
2. Use a Phillips screwdriver to loosen the battery compartment door screw, and remove the door from the case bottom.
3. Remove the batteries.
4. Replace the batteries with two new AA batteries.
5. Reattach the battery compartment door to the case bottom and tighten the screw.

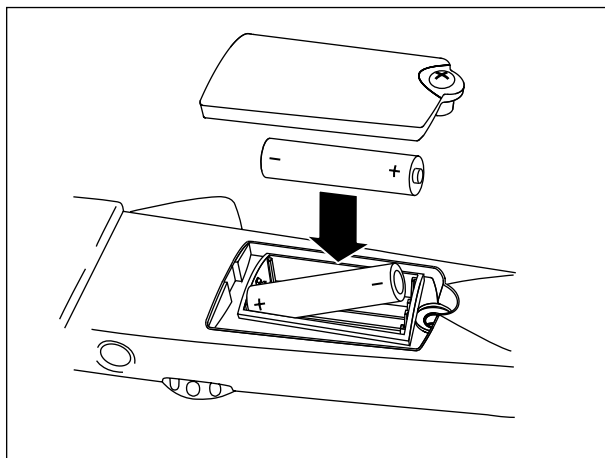

efu0002.eps

Figure 6. Battery Replacement

Specifications



Electrical Specifications

Function	Range	Resolution	Accuracy
Voltage DC	0 – 600 V	0.1 V	1 % ± 5 counts
Voltage AC (True Rms)	0 – 600 V	0.1 V	1 % ± 5 counts (50/60 Hz)
Current AC (True Rms)	0 – 600 A	0.1 A	2.0 % ± 5 counts (50/60 Hz)
Current DC	0 - 200 μ A	0.1 μ A	1.0 % ± 5 counts
Resistance	0 – 999 Ω 0 – 9999 Ω	0.1 Ω 1.0 Ω	1.5 % ± 5 counts
Continuity	< 30 Ω		
Temperature	-10 to 400 $^{\circ}$ C	0.1 $^{\circ}$ C	1 % ± 0.8 $^{\circ}$ C
Capacitance	1-100 μ F 100-1000 μ F	0.1 μ F 1 μ F	1.9 % ± 2 counts

General Specifications

Operating Temperature	-10 °C to +50 °C
Storage Temperature	-40 °C to +60 °C
Operating Humidity	Non condensing (< 10 °C) 90 % RH (10 °C to 30 °C) 75 % RH (30 °C to 40 °C) 45 % RH (40 °C to 50 °C) (Without Condensation)
Operating Altitude	2500 meters above mean sea level
Storage Altitude	12,000 meters above mean sea level
IP Rating	IP 30 per IEC 60529
Vibration Requirements	MIL-PRF-28800F Class 2 random vibration
EMI, RFI, EMC	EMI: instrument unspecified for use in EMC field • 0.5 V / Meter EMC: Meets all applicable requirements in EN61326-1
Temperature Coefficients	0.1 x (specified accuracy)/ °C (<18 °C or >28 °C)

HVAC Clamp Meter Specifications

Size (H X W X L)	9.1 x 3.8 x 1.7 inches (240 x 80 x 40 mm)
Weight	1.1 lb (310 g)
Design Standards and Compliance	IEC 61010, IEC 61010-2-032, CE
Agency Approvals	    N10140
Over-voltage Category	600 V, CAT III per IEC 1010-1 CAT III equipment is designed to protect against transients in equipment in fixed-equipment installations, such as distribution panels, feeders and short branch circuits, and lighting systems in large buildings.
Power Requirements	Two AA Batteries, NEDA 15 A, IEC LR6



[Back to the Fluke 902 Product Info Page](#)



[Visit us at www.TestEquipmentDepot.com](http://www.TestEquipmentDepot.com)